



Transducers UFA and UVA in LDG16 housing

Operating Instructions

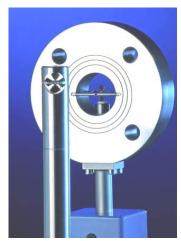





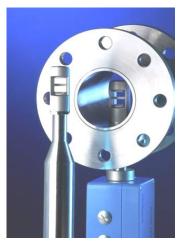

Vortex flow sensors VA

Höntzsch GmbH

P.O. Box 1324 D-71303 Waiblingen Gottlieb-Daimler-Straße 37 D-71334 Waiblingen (Hegnach)

Tel: 07151/1716-0 Fax: 07151/58402

E-Mail info@hoentzsch.com Internet www.hoentzsch.com

Contents

- 1 Safety Symbols
- 2 Application according to Regulations
- 3 Operating Safety
- 4 Scope of Delivery
 - 4.1 Description, Type Plates
- 5 Technical Specifications
 - 5.1 Conformity with Standards

 - 5.1 Conformity with Standards
 5.2 Storage Conditions
 5.3 Operating Conditions
 5.4 Compatibility
 5.5 Housing and Connectors
 5.6 Electrical Data
 5.7 Measurement Uncertainty

6 Installation

- 6.1 Block Diagram
- 6.2 Wiring Diagrams
 - 6.2.1 Power supply
 - 6.2.2 Sensor input
 - 6.2.3 Analog output
 - 6.2.4 Relay output
 - 6.2.5 Interface RS232
- 6.3 Tips on Electromagnetic Compatibility (EMC)
- 6.4 Connecting Cable
- 7 Functional Description
- 8 Settings
- **9 Performance Test**
- 10 Initial Operation
- 11 Operation
- 12 Shut-down, Dismantling
- 13 Inspection
- 14 Maintenance
- 15 Calibration
- 16 Troubleshooting
- 17 Returns
- 18 Disposal
- 19 Replacement Parts
- 20 CE Declaration of Conformity, Manufacturer's Declaration



1 Safety Symbols



Warning!

Failure to observe the instructions can result in serious injury and damage to property!



Important notice!

Non-observance can result in serious damage to the equipment or restriction in performance!

2 Application according to Regulations



Transducers UFA and UVA are instruments for measuring flow velocity and flow rate:

UFA for use with vane wheel flow sensors FA or FAR and measuring tubes FA Di or FAR Di and UVA for use with vortex flow sensors VA40 and measuring tubes VA Di. These instruments are designed for industrial application. The LDG16 is a mounting rail housing in protection class IP20 designed primarily for use in control cabinets.

The manufacturer is not liable for damage caused by improper use and/or non-compliance with the regulations.

Do not carry out any structural modifications to the transducers.

Always follow the instructions on the type plate, especially the information regarding supply voltage.

3 Operating Safety



All steps described below must be carried out by qualified personnel only!

Please read the Operating Instructions carefully before unpacking the equipment!

Safety can only be guaranteed if the equipment is operated in accordance with the regulations. Improper handling can result in serious injury and damage to property.

4 Scope of Delivery

- Transducer UFA or UVA for mounting rail assembly
- Operating Instructions, Data Sheet
- CD-ROM with PC configuration software UCOM (optional)
- Interface cable RS232 for PC COM port connection (optional)
- USB adapter in addition to the interface cable RS232 (optional)

Please check that everything listed in the Delivery Note / Technical Data Sheet is included in the delivery.

4.1 Description, Type Plates

One of the following type plates can be found on the side of the housing:







Type plate UVA

Type: **UFA** : transducer for vane wheel sensors UVA : transducer for vortex sensors S/N.: : serial number 230 VAC : supply voltage 230 V AC voltage Power: 24 VDC : supply voltage 24 V DC voltage 12 VDC : supply voltage 12 V DC voltage : input for vane wheel sensors FA or FAR Input: FA/FAR : input for vortex sensors VA Filter: : filtration of vane wheel input frequency Output: 4-20 mA : analog output current 4-20 mA 0-10 V : analog output voltage 0-10V RS232: : behind the front cover

5 **Technical Specifications**

5.1 **Conformity with Standards**

Transducers UFA / UVA are manufactured according to the best available technology, are safe and reliable and comply with the relevant regulations, EU directives and standards.

DIN EN 60715 and SN EN 50022: mounting rail housing DIN VDE 0100 and VGB4 shock-proof terminals IEC 529 and EN 60 529 protection class IP20

EN 61 000-6-2 / IEC77



Storage Conditions

Storage temperature: -30 to +70 °C





5.3 Operating Conditions

ambient air temperature in use : 0 to +50 °C

place of installation : control cabinet on mounting rail EN 50022

protection class : IP20

mounting attitude : no restrictions

5.4 Compatibility

All Höntzsch vane wheel probes FA or FAR and all Höntzsch vane wheel measuring tubes FA Di or FAR Di (without integrated transducer) can be connected to the UFA transducer.

The UFA replaces the U2a transducer with FA / FAR input.

All Höntzsch vortex probes VA and all Höntzsch vortex measuring tubes VA Di (without integrated transducer) can be connected to the UVA transducer. The UVA replaces the U2a transducer with VA input.

5.5 Housing and Connectors

The LDG16 housing is designed for snapping on to 35mm DIN rail according to DIN EN 60715 and SN EN 50022 or for screwed connection. It is an insulator housing complying with machine and automobile industry regulations with 16 shock-proof terminals according to DIN VDE 0100 and VGB4, for wires with cross-section 0.14 ... 4 mm².

Protection class : housing IP40, terminals IP20

Material : Macrolon connections : by terminals

external dimensions : W/H/D = 55/75/110 mm

5.6 Electrical Data

Supply voltage, mains supply:

230V AC (215 ... 255 V AC), 50 ... 60 Hz, power < 10 VA 24 V DC (20 ... 27 V DC), power < 5 W 12 V DC (10 ... 17 V DC), power < 5 W

The mains supply is electrically isolated from the UFA/UVA inputs and outputs.

UFA input flow v/FA or v/FAR:

for Höntzsch vane wheel flow sensors FA and FAR designed as probes (ZS, TS \dots , ZSR, TSR \dots) and as measuring tubes (FA Di, FAR Di \dots).

When using sensors in Ex-zone category 2 an isolation/supply unit (e.g. LDX2) is an essential requirement.

UVA input flow v/VA:

for Höntzsch vortex flow sensors VA designed as probes (VA40 \dots) and as measuring tubes (VA Di \dots). When using sensors in Ex-zone categories 1 and 2 an isolation/supply unit (e.g. LDX2) is an essential requirement.

UFA analog output:

```
for FA and FAR*: 4 ... 20 mA
                                                     0 ... x m/s
                                                                    (or m^3/h),
             : 4 ... 12 ... 20 mA
                                             -x ... 0 ... +x m/s
                                                                    (or m^3/h),
                                     =
  terminal values x configurable / burden max. 400 Ohm
alternative:
  for FA and FAR*: 0 ... 10 V
                                                     0 ... x m/s
                                                                    (or m^3/h),
           : 0 ... 5 ... 10 V
                                             -x ... 0 ... +x m/s
                                                                    (or m^3/h),
  terminal values x configurable / impedance 1 kOhm
```

^{*} for FAR sensors when configuring the relay: ±flow direction

UVA analog output:

 $4 \dots 20 \text{ mA} = 0 \dots x \text{ m/s (or m}^3/\text{h)},$ terminal value x configurable / burden max. 400 Ohm, alternative: $0 \dots 10 \text{ V} = 0 \dots x \text{ m/s (or m}^3/\text{h)},$ terminal value x configurable / impedance 1 kOhm

Relay: (potential-free change-over contact), max. 300 mA / 27 V DC configurable as limit value v, quantity pulse or ±flow direction (see under 7 Functional Description)

RS232 interface:

for connection with UCOM (see under 7 Functional Description) 9600 Baud, 8Bit, no parity, 2 stop bits, Xon/Xoff

5.7 Measurement Uncertainty


Recording the measurement frequency (at 1000 Hz): <0.1%Analog output (terminal value): <0.15%Linearity error: <0.1%Temperature coefficient: <20 ppm/K (at 25 °K temperature difference equivalent to <0.05%)




6 Installation

The current European Specifications for Assembly, the recognised standards of good practice and this Operating Instructions apply.

6.1 Block Diagram

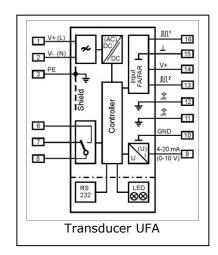

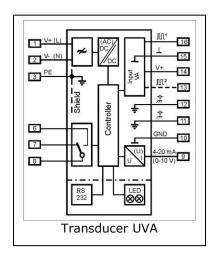





6.2 Wiring Diagrams

Electrical connection must be carried out according to the appropriate wiring diagram. Faulty connection can cause damage to persons and destruction of the electronics.

Do not install or wire up the transducer under mains voltage. **Non-compliance can cause damage to persons and destruction of the electronics.**

In this connection and depending on the configuration of the equipment, one of the following wiring diagrams must be taken into account. Wiring diagrams for measuring systems in customer-specific design will be supplied separately.





6.2.1 Power supply

Before connecting please check that the power supply is within the specification. The type plate with all relevant information can be found on the side of the UFA and UVA housing.





With a supply voltage of 230 VAC please ensure that the non-insulated areas of terminals and connecting cables are not touched when live!

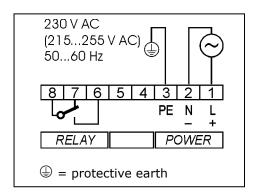

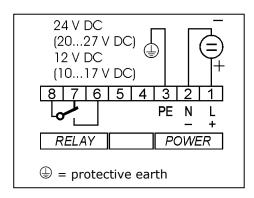


6.2.2 Sensor input

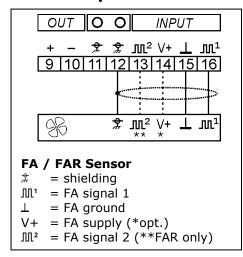


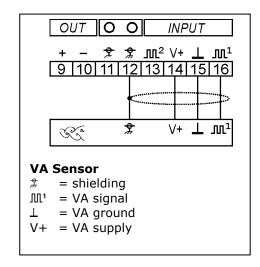

If the housing has cable entry points, shielding of the sensor connecting cable is contacted at cable entry point.

6.2.3 Analog output

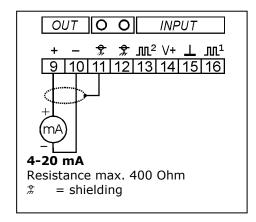


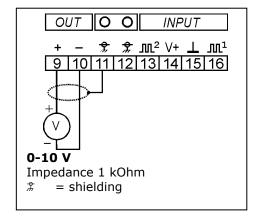

The type plate with all relevant information can be found on the side of the UFA and UVA housing.

The terminal value of the analog output can be configured with the PC software UCOM via the RS232 interface. The customer-specific programmed value can be found in the accompanying documents.

6.2.4 Relay output

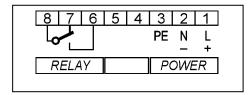

The change-over contact of the relay is shown in rest position (relay coil off).

The function of the relay output and the corresponding setting parameter can be configured with the PC software UCOM via the RS232 interface. The customer-specific settings can be found in the documentation.

6.2.5 RS232 Interface



Fig. 1: Unscrew the front cover

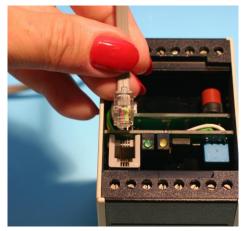


Fig. 2: Connection RS232 interface cable with RJ22 plug with front cover open

The RS232 interface connection is behind the front cover. After removing the front cover (see Fig 1) the RJ22 plug of the PC connecting cable can be plugged into the socket (see Fig 2). PC connection follows at a COM port or with an optional USB adapter.





6.3 Tips on Electromagnetic Compatibility (EMC)

- all connecting cables are to be kept as short as possible
- with cable routes longer than 30 m or with strong electromagnetic disturbance along the cable route between sensor and evaluation unit, the use of a double-shielded cable is recommended: to do this lay inner shielding to one side of the evaluation unit and lay outer shielding on both sides over a large area with low-impedance connection on the sensor and evaluation unit or on the control cabinet
- do not loop or kink the cable
- lay non-allocated cable strands on both sides on protective potential
- lay cables as close to ground as possible, as for example side panels, mounting plates or steel girders
- when using frequency converters there is a risk of HF interference. Therefore, decouple the power input of the frequency converter against active emitted interference using a radio interference filter. This also increases the passive interference resistance of the facility
- between engines and converters use only shielded engine cables, with double-sided shielding overlay
- spacially separate cables which emit interference from measuring lines and evaluation units. If necessary, lay measuring lines in a metallic tubular cable protection
- metallic parts in control cabinets such as subracks with control electronics or subplates to be connected over a large area and HF-wise suitably conductive
- wire relays, switches and magnetic valves installed in the same circuit, using spark extinguisher combinations or over-voltage limiting components
- apply analog signal cable shielding on one side only preferably on the evaluation unit and low resistant. Twist unshielded cables against balanced induction
- apply digital signal cable shielding on both sides over a large area. In the case of potential differences between these points it is advisable to lay a separate equipotential bonding conductor
- allow for preferred shielded connector for connections to points of separation of connection cables. Terminals should be situated in HF-tight housing, with suitable EMC cable entry points. Contact outer shielding of the connection cables to the cable entry points.

6.4 Connecting Cable

For connecting between sensor and evaluation unit LiYCY cable with simple copper braiding screen can be used if the cable route is short and there is marginal electromagnetic interference. Over longer distances or with a high rate of electromagnetic interference, a double-screened cable of type LiYCY-CY should be used.

Sensor FA 2 (3) x 0.25 mm²
Sensor FAR 3 (4) x 0.25 mm²
Max. permissible conductor resistance per strand is 25 Ohm.
Max. permissible operating capacity between 2 strands is 1.5 nF.

Sensor VA 3 x 0.25 mm²

Max. permissible conductor resistance per strand is 15 Ohm.

Conductor resistances for finely stranded conductors:

approx. 79 Ohm/km with wire cross section 0.25 mm² approx. 39 Ohm/km with wire cross section 0.50 mm² approx. 26 Ohm/km with wire cross section 0.75 mm²

7 Functional Description

UFA transducers are designed for connecting to vane wheel probes FA and FAR (directional sensing) and vane wheel measuring tubes FA Di and FAR Di (directional sensing) for measuring flow velocity or flow rate of air/gases and water/liquids.

UVA transducers are designed for connecting to vortex probes VA and vortex measuring tubes VA Di for measuring the flow velocity or flow rate of air/gases.

The signal frequency proportional to the velocity generated from the flow sensor is converted to a linear **analog output signal** 4-20 mA or 0-10 V. The analog terminal value is configurable. When logging directional sensing data the zero point can be selected in the middle of the analog range or directional sensing takes place with the help of the relay output:

for FA and FAR*: 4 ... 20 mA 0 ... x m/s (or m³/h)for FAR: 4 ... 12 ... 20 mA -x ... 0...+x m/s (or m³/h)= for VA: 4 ... 20 mA = 0 ... x m/s (or m³/h)alternatively: for FA and FAR*: 0 ... 10 V = 0 ... x m/s (or m³/h)0 ... 5 ... 10 V -x ... 0...+x m/s (or m³/h)for FAR: for VA: 0 ... 10 V 0 ... x m/s (or m³/h)* for FAR sensors for configuring the relay see under: ±direction of flow

The actual velocity or actual flow rate can be converted to standard velocity or standard flow rate by entering the parameter for temperature and pressure.

A relay output (change-over contact) can be configured for 1 of 3 different functions:

1. as **limit value** for the flow velocity or the flow rate:

flow velocity < or = limit value: relay contact idle

flow velocity > limit value: relay contact in working position

2. as **quantity pulse** for quantity measurement:

max. pulse repetition frequency 1 Hz per unit of volume,

configurable, e.g. 1 pulse per 1, 10 or 100 (norm)-m³ or (norm)-litre

pulse duration 0.1 s (FAR sensors: configurable for '+' or '-' amounts)

3. as \pm direction of flow ** (for FAR sensors only):

+direction: relay contact in idle

- direction: relay contact in in working position

** analog output (see above) is then absolute value of flow only, without direction

Self diagnosis according to NAMUR NE43:

No error: yellow LED off

green LED on (flow velocity = 0) or

green LED flashes (flow velocity > 0)

Error: yellow LED on and with

- analog output 4-20 mA : < 3.6 mA

- analog output 0-10 V : < -0.2 V

Monitored: power supply, data logging, sensor interface, parameter settings (see under 16: Trouble-shooting)

PC serial port RS232:

for changing calibration data and setting parameters.

Remove front cover (see Fig. 1)

Plug PC connector cable (optional) with RJ22 into the socket in the transducer (see Fig. 2).

Connect other end of cable to PC COM port.

If a USB connection is required, then an optional USB / RS232 interface converter must be inserted. Changes to the settings can now take place after starting the PC programme UCOM (optional) (see under 8: Settings).



8 Settings

The following setting parameters can be read using the PC software UCOM and are also alterable. The customer-specific settings are shown on the parameter print-out, which is included in the documents.

Please find operation instructions PC software UCOM in document U385.



9 Performance Test

sensor not connected

(pay attention to 6.2.1 Power supply and 6.2.3 Analog output) after connecting the supply voltage the green and yellow LED light up. The analog output sends a value between 3.4 mA and 3.6 mA with output current or between -0.3 V and -0.2 V with output voltage.



10 Initial Operation

sensor connected

(pay attention to 6.2.1 Power supply, 6.2.2 Sensor input and 6.2.3 Analog output) after connecting the supply voltage the green LED lights up and the yellow LED is off.

No flow at sensor: the green LED is permanently on, the analog output sends a value of 4 mA with output current (or 12 mA depending on configuration with FAR sensors) or with output voltage a value of 0 V (or 5 V depending on configuration with FAR sensors, see under 7 Functional Description)

Flow at sensor: the green LED flashes, the analog output sends an analog value deviating from the zero flow conditions (see above).



11 Operation

(Pay attention to 5.3 Operating Conditions and 5.6 Electrical Data)



12 Shut-down, Dismantling

Before disconnecting the cable, please ensure that the supply voltage is switched off.

13 Inspection

Checking the LEDs, (see under 7 Functional Description, Self diagnosis)



14 Maintenance

Only use cleaning agents which dry without leaving any residue and which are compatible with the housing materials.

15 Calibration

The UFA and UVA transducers have an excellent long-term stability. However, it makes sense to have the instruments calibrated at certain intervals. The period between two calibrations depends on the individual operational conditions and the tolerable measurement error. Therefore, as a precaution, shorter calibration cycles should be chosen at the beginning. As an indication and under 'normal' operating conditions a calibration cycle of approx. 3-5 years applies.

Transducers must be returned to the manufacturer for calibration. Please refer to Section 17!



16 Troubleshooting

Fault	Cause	Troubleshooting
green LED does not light	no power supply	check connecting cable, measure volt-
up		age at connecting terminals
	transducer electronics faulty	return to factory
yellow LED lights up,	cable break or short-circuit	check terminals,
green LED does not flash		check cable for continuity and replace if
despite flow, analog		necessary
output = error (<3.6 mA	transducer or sensor electronics	return to factory
or < -0.2V)	faulty	
yellow LED lights up,	parameter error	check parameter with UCOM software,
green LED flashes with		save new checksum
flow, analog output =		(or return to factory)
error (<3.6 mA or < -0.2V)	transducer electronics faulty	return to factory
no measured value	sensor contaminated	clean sensor according to instructions
	coefficient set at 0.000	set coefficient at '1.000'
measured value too low	sensor contaminated	clean sensor according to instructions
	coefficient setting too low	set coefficient at '1.000'
	input/output section too short	change sensor position, improve flow
		conditions with a flow rectifier
	rotational flow	reposition sensor in flow direction, in-
		stall flow rectifier
	vortex VA sensors:	return sensor to factory for performance
	reduced acoustic coupling in the	test
	sensor elements as a result of	
	intense vibration or powerful	
	impact	
	burden at current ouput is	reduce resistance
	greater than specified in the	
	Technical Data Sheet resulting	
	in correct output values in the	
	lower range and no longer in-	
	creasing values at the top end	
	of the measuring range	
	incorrect scaling of analog out-	check setting and amend if necessary
	put	
measured value too high	coefficient set too high	set coefficient at '1.000'
	EMC problem	see under 6.3

17 Returns

No special measures necessary for UFA and UVA transducers.

When returning sensors, these should be cleaned thoroughly according to the instructions. A hazard warning or declaration of no objection must be supplied for substances which have been in contact with the sensor or possibly infiltrated the cavities in the sensor. If adhesion of hazardous substances cannot be ruled out, then detailed safety measures to be taken when handling the equipment must be itemised.

18 Disposal

The customer should assume the duty to dispose of the equipment at his own expense and according to statutory provisions (e.g. ElektroG in Germany).

19 Replacement Parts



Fig.3 Fuse TR5

Fuse TR5 accessible by removing the front cover and visible top right in Fig.3:

for 230 V AC TR5-T 100 mA order no. e025/023 for 24 V DC TR5-T 500 mA order no. e025/024 for 12 V DC TR5-T 500 mA order no. e025/024

The fuse is inserted in the base.



Always switch off before changing the fuse!

20 CE Declaration of Conformity, Manufacturer's Declaration

We herewith declare, that all appliances and sensors manufactured by us comply with the regulations of the EMC Directive 2004/108/EC, the Pressure Equipment Directive 97/23/EC and the Safety of Machinery Directive 2006/42/EC.

The structural components comply with the following generic standards/directives:

- Low Voltage Directive (2006/95/EC)
- Safety of Machinery Electrical Equipment of Machines (IEC 60204)
- Safety Requirements for Electrical Equipment for Measurement, Control and Laboratory Use (IEC 61010)
- Electrical Systems and Devices (VBG 4)
- Generic Standards, Immunity for Industrial Environments (IEC 61000-6-2)
- Generic Emission Standard, Industrial Environment (IEC 61000-6-4)

Thomas Itte / Managing Director HÖNTZSCH GmbH

